

Installation Instructions M36533c





These instructions apply to:


Connectors with **EIA-flanges**

 
for cable **HCA400-50**


Figures show 3 1/8"EIA (50 Ω) connectors

 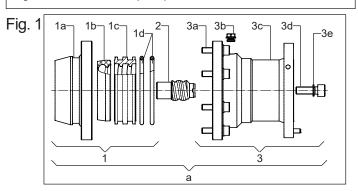


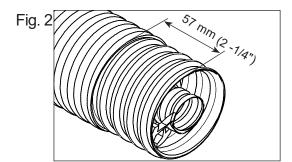


 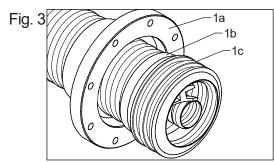




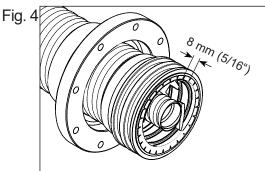



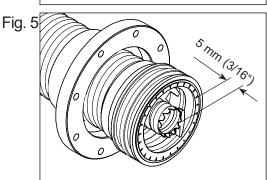



These instructions were written for qualified and experienced personnel. Please read them carefully before starting work. Any liability or responsibility for the results of improper or unsafe installation practices is disclaimed! Please respect valid environmental regulations for assembly and waste disposal!

Tools and Materials

Measuring tape, cable knife, saw, flat file, flat pliers, metal shears, scraper, hexagon socket screw key size 6 and 8, open-ended spanner 11 mm (7/16") for gas inlet, 3 mm (1/8") drill bit, mandrel Ø 3 (1/8") hammer, plastic hammer or flaring rod (hard wood).

Connector disassembly, Fig. 1

- a) Disassembly of connector.
 - 1 Connector back end
 - 1a Back nut
 - 1b Gasket
 - 1c Clamping ring
 - 1d O-rings
 - 2 Screw unit (inner conductor)
 - 3 Connector head
 - 3a Hexagon screw (M8)
 - 3b Gas inlet screw (1/8" NPT)
 - 3c Connector outer conductor
 - 3d Hexagon screw (M10)
 - 3e copper sealing

Cable trimming, Fig. 2

 b) Clean cable end and saw it off rectangular to cable axis.

Caution: Do not deform cable while trimming! Cut back cable jacket. Please observe that no metal particles get inside of the cable. It is recommended to seal the cable inside with a cloth temporarily. Deburr sawing edges! Remove all metal particles!

Preparing of outer conductor, Fig. 3

- c) Slide part (1a) over the cable.
- d) Lubricate gasket (1b) with the supplied grease for easy installation.

Screw part (1b) onto outer conductor close against lacket

Check smooth fit of part (1b) in the cable corrugation.

e) Screw part (1c) against part (1b)

Notice: Observe the cone direction of the gasket!

Flaring of outer conductor, Fig. 4

f) Cut slits in the protruding outer conductor in axial direction until part (1c). The spacing of the slits shall be aprox. 8 mm (5/16").

Flare outer conductor segments outwards against part (1c). Use flaring rod (hard wood).


The flared cable outer conductor must be equally thick, if not it can be obtained by finishing this flared area with a file. The flared sebments that exced the diameter of part (1c) must be cut back with metal shears of flat file.

Flaring of inner conductor, Fig. 5

g) Deburr inner conductor. Cut off protruding insulating helix even with outer conductor. Cut notches with metal shears (recommended: 12 notches).

Notice: Observe that the cloth has been removed after trimming!

Ensure the insulating helix remains in its original path. Do not push or stretch the insulating helix!

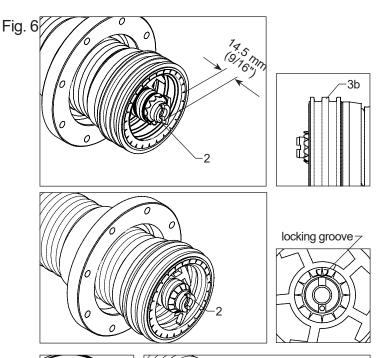



Preparing of inner conductor, Fig. 6


- h) Screw part (2) into cable inner conductor. Adjust part (2) with mandrel Ø3 (1/8") or screw driver.
- i) Push one jag of cable inner conductor into locking groove of part (2).

Flare back cable inner conductor, making sure that part (2) does not change its position.

The flared cable inner conductor must be equally thick, if not it can be obtained by finishing this flared area with a file. Overlaying tabs must be reworked. Remove protruding flaring edges.

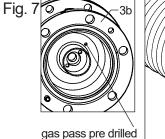

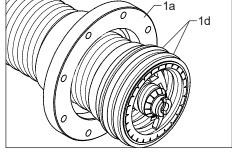

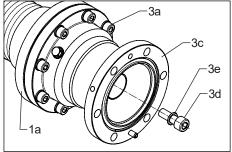

 


Fig. 8

Fitting of connector head, Fig. 7

- j) If a gas pass connector is needed drill through pre drilled hole in the insulator with 3 mm (1/8") drill bit.
- **k)** Put o-rings (1d, 2x) into grooves of part (1c). Apply supplied grease to parts (1d).

Slide part (1a) onto part (1c).

Slide part (3c) onto part (1c) of prepared cable end. Tightly and equally screw together part (3c) and part (1a) with hexagon socket screws parts (3a). Torque 17 Nm (12.5 ft.-lb.) approx.

At correct installation a small gap will remain between part (1a) and part (3c).

Screw up hexagon screw (3d) and copper sealing (3e) with part (2). Torque 50 Nm (37 ft.-lb.) approx. Note: In case of repeated assembly exchange the worn-out copper sealing part (3e) with the enclosed spare sealing.

Gas inlet (if required), Fig. 8

m) Remove part (3b) and install a suitable tube adapter.

page 2 of 2



部件名称/Component	有毒有害物质或元素/Toxic or Hazardous Substances and Elements					
Name	铅/Pb	汞/Hg	镉/Cd	六价铬/Cr 6+	多溴联f/PBB	多溴二f醚/PBDE
金属零件/metal parts	Х	0	0	0	0	0

产品在正常使用条件下,其环保使用期限才在此标识有效期内. / The environmental protection use period is valid if the product is used as intended.